



Firmware Version: V1.05.02 **Prom Code Version:** Published Date: 2015/3/6

Content:

| Upgrading Instructions: | 2 |
|-------------------------|---|
| New Features: | 2 |
| Problems Fixed: | 2 |
| Known Issues: | 3 |
| Related Documentation: | 3 |



| Revision History and System Requirement: | | | | | |
|--|------------|-----------|------------------|--|--|
| Firmware Version | Date | Model | Hardware Version | | |
| V1.05.02 | 2015/3/6 | DCS-2332L | A1, A2 | | |
| V1.04.00 | 2014/12/24 | DCS-2332L | A1, A2 | | |
| V1.03.06 | 2014/7/14 | DCS-2332L | A1, A2 | | |
| V1.02.00 | 2013/7/29 | DCS-2332L | A1 | | |
| V1.01.04 | 2013/6/18 | DCS-2332L | A1 | | |
| | | | | | |

Upgrading Instructions:

Follow the steps below to upgrade the firmware:

- 1. Download the latest firmware file from the D-Link website. The file is in .bin file format.
- 2. Log-in camera web UI and enter setup/Maintenance/Firmware upgrade
- 3. Click Browse... and specify the firmware file.

3. Click Upgrade. The camera starts to upgrade and will reboot automatically when the upgrade completes.

New Features:

| Firmware Version | New Features |
|---------------------|---|
| V1.05.02 | 1. Update the mydlink agent to 2.0.19-b02 |
| | 1. Update the mydlink agent to 2.0.18-b54 |
| V1.04.00 | 2. Disable the SSL2.0/3.0 |
| | 3. Disable the RC4/DES |
| | 1. Update the mydlink agent to 2.0.17-b76 |
| | 2. Support MP4 recording format |
| V1.03.06 | 3. Added Schedule Reboot function |
| | 4. Meet new EU wireless regularization EN300 328 v1.8.1 |
| | 1. Update the mydlink agent to 2.0.17-b18 |
| | 2. Support 2-way audio function at portal and APP |
| V1.02.00 | 3. Support onvif test tool V12.06 |
| | 4. Enhancements the low light image. |
| V1.01.04 | Upgrade to UPnP v1.6.18. |
| | |

Problems Fixed:

| | Firmware Version | Problems Fixed |
|----------|---------------------|----------------|
| dlinkian | een | |



| | 1. Fixed the 2-way audio failed issue on iOS8 |
|----------|---|
| V1.05.02 | 2. Fixed the issue of faulty auto-firmware upgrade mechanism |
| | 3. Fine-tune the wireless performance |
| V1.04.00 | 1. Remove the PSIA protocol. Fixing getting the snapshot without authentication. |
| | 1. Fixed the issue of ICR switch failed in schedule mode after device reboot. |
| | 2. Modified that when pre/post event image is set as 0, the device should send off one snapshot. |
| | 3. Modified FTP time-out to 240 seconds. |
| | 4. Fixed the issue that the device isn't deleted from mydlink after factory reset and re-connecting to Internet. |
| | 5. Fixed the issue that failed to delete the first user info in the guest list. |
| | 6. Fixed the issue that when SD memory size is full by recording, the e-mail notification isn't sent off. |
| V1.03.06 | 7. Fixed the issue that mydlink account is cleared out after downgrading to the previous FW version. |
| | 8. Fixed the issue that cannot find wireless network when change security mode from WPA to WEP. |
| | 9. Fixed the issue that the device can't rescan any SSID after changing from wireless to wired connection in some operation step. |
| | 10. Fixed the issue that some recording files in SD card didn't have audio sound. |
| | 11. Fixed the issue that camera IP doesn't update to DDNS. |
| | 12. Modified the event setup that needs to create 2 media for 2 events. |
| V1.01.04 | 1. Remove the default account "guest". |
| VI.UI.U4 | 2. RTSP Authentication is default enable. |
| | |

Known Issues:

| Firmware Version | Known Issues |
|---------------------|--|
| V1.03.06 | Spec change: G.726 audio codec wouldn't be supported in FW v1.03 or later. |
| | |

Related Documentation:

N/A