



Firmware Version: V1.03.07
Prom Code Version:
Published Date: 2016/5/12

Content:

Upgrading Instructions:..... 2

New Features:..... 2

Problems Fixed: 3

Known Issues: 3

Related Documentation: 3

Revision History and System Requirement:

Firmware Version	Date	Model	Hardware Version
V1.03.07	2016/5/12	DCS-5025L	A1
V1.02.10	2015/10/01	DCS-5025L	A1
V1.01.05	2015/07/15	DCS-5025	A1
V1.00.20	2015/05/15	DCS-5025L	A1

Upgrading Instructions:

Follow the steps below to upgrade the firmware:

1. Download the latest firmware file from the D-Link website. The file is in .bin file format.
2. Log-in camera web UI and enter setup/Maintenance/Firmware upgrade
3. Click Browse... and specify the firmware file.
3. Click Upgrade. The camera starts to upgrade and will reboot automatically when the upgrade completes.

New Features:

Firmware Version	New Features
V1.03.07	<ol style="list-style-type: none"> 1. Update Mydlink Agent to v2.0.20-b22 2. Upgraded OpenSSL to 1.0.1q 3. Change the HTTPs self-signed certificate to SHA2 algorithms. 4. Change the default system time to 2016-01-01 5. Change the copyright year in the web-UI to 2016. 6. Support to send the email notification to multiple email addresses. Note: Multiple recipients must be separated by a semicolon, ';'. 7. Add the authentication mechanism for CGI command: config/stream_info.cgi. 8. Modify the CSRF response to follow the D-Link CSRF specification.
V1.02.10	<ol style="list-style-type: none"> 1. Update to agent 2.0.19-b85 2. Adds functionality to prevent CSRF in Web-UI. 3. If adding an existing user account, the web-GUI now pops-up warning.
V1.01.05	<ol style="list-style-type: none"> 1. Update to agent 2.0.19-b49 2. Reduced WPS timeout flash time 3. Added Audio noise filter and changed default volume to 50
V1.00.20	<ol style="list-style-type: none"> 1. Initial Release supporting mydlink Home app

--	--

Problems Fixed:

Firmware Version	Problems Fixed
V1.03.07	<ol style="list-style-type: none"> 1. Fixed an issue where IP Camera blocks CGI request from Chrome and Edge. 2. Fixed an issue where IP Camera can't auto connect to the specific wireless network when it drops wireless connection. 3. Fixed an issue that Time zone setting for Minsk should be GMT+3.
V1.02.10	<ol style="list-style-type: none"> 1. Fix the Device Time Zone mismatch issue. 2. Fixed IP Cam issue where device fails to connect to wireless network when serially connecting to wireless routers using WPS PBC method 3. Fixed the issue where Direct Mode DHCP server will deliver dynamic IP address to the AP Client interface of IP Camera. 4. Fixed PPPoE auto-reconnect failure when unplug/replug Ethernet cable. 5. Fixed issue where Direct mode does not work properly when device is powered on without Ethernet connection. 6. Adjusted wlan0_ssid and dcs state value on Bonjour TXT record
V1.01.05	<ol style="list-style-type: none"> 1. Fixed WPS performance with Atheros Chipset Routers 2. WPS process will return to Direct mode if timeout/failure occurs
V1.00.20	<ol style="list-style-type: none"> 1. Initial Release

Known Issues:

Firmware Version	Known Issues
V1.00.20	Continuous Snapshot to FTP will cause loading issues.

Related Documentation:

N/A