



#### Firmware Version: V3.01 Prom Code Version: Published Date: 2015/10/15

### **Content:**

| ograding Instructions: Error! Bookmark not defined the second secon |  |
|---|--|
| New Features:   |  |
| Problems Fixed:   |  |
| Known Issues:   |  |
| Related Documentation:  |  |



### Revision History and System Requirement:

| Firmware Version | Date       | Model    | Hardware Version |
|------------------|------------|----------|------------------|
| V1.00            | 2010/12/22 | DCS-7110 | A1               |
| V1.10            | 2012/8/01  | DCS-7110 | A2               |
| V1.20            | 2012/8/31  | DCS-7110 | A3               |
| V3.00            | 2013/1/9   | DCS-7110 | В1               |
| V3.01            | 2015/10/15 | DCS-7110 | В1               |

## Upgrading Instructions:

Follow the steps below to upgrade the firmware:

1. Log-in camera web UI and enter setup/Maintenance/Firmware upgrade

2. Click Browse... and specify the firmware file.

3. Click Upgrade. The camera starts to upgrade and will reboot automatically when the upgrade completes.

### **New Features:**

| Fireware<br>Version | New Features   |
|---------------------|--|
| V1.10               | Support PPPoE CHAP.  |
| V1.10               | Approval by ONVIF test tool v1.02.4.   |
| V1.20               | Support NIPCA motion detection cgi.  |
| V3.00               | <ol> <li>Support 1920x1080 for HW B1 version.</li> <li>Camera Name &amp; Page Title change to 64 Bytes.</li> </ol> |

# **Problems Fixed:**

dlinkigreen

| Firmware<br>Version | Problems Fixed   |
|---------------------|--|
| V1.10               | <ol> <li>D-Track no. DBG11060237 &amp; DRU20110614000005, camera doesn't respond<br/>by the default IP address.</li> <li>Image noise issue in night mode.</li> </ol> |
|                     | 1. DBG10120098 : Add default icon in Image Settings (Profile 1).   |
|                     | 2. DBG11110304 : After disable DUT HTTPS secure connection, DUT redirect to HTTP webpage with HTTPS port.  |
| V1.20               | 3. DBG11110317 : After change logo graph, the title name would overlap the left logo graph in live view page.  |
|                     | 4. DBG11110318 : The copy button in HTML Code Examples page didn't work.   |
|                     | 5. DBG12010013: When change DUT HTTP/RTSP port to 8081/5544, browse DUT H.264 using QuickTime plugin HTML code example by Firefox would show                         |



|       | connection failed.   |
|-------|--|
|       | 6. DBG11100155 : After firmware upgrade the logo graph settings would disappear.   |
|       | 7. DBG11100146 : Recording notify message file didn't show the right folder path of network storage server. (Remove the path information)  |
|       | 8. DBG11110280 : The values of default and output frame size setting cannot be synchronized.   |
| V3.00 | <ol> <li>Change CBR max. option from 6M to 8M for saving bandwidth.</li> <li>IR sometimes has inconsistent situation. (Display shows Day mode, IR LEDs are ON at the same time)</li> <li>When create HTTPS certification, popup Certificate Request window has chance to show can't find home page.</li> <li>Remove "one hour" in updating interval of NTP.</li> </ol>   |
| V3.01 | <ol> <li>Change to 2015 version Digital Signature.</li> <li>Security holes issues.         <ul> <li>a. RTSP authentication.</li> <li>b. Slowloris HTTP DoS.</li> <li>c. Password Stored in Web Page.</li> <li>d. Open SSL binary transmitting.</li> </ul> </li> <li>Disable SIP port, FTP port, SSL v3.0.</li> <li>Change RTSP default authentication to Basic.</li> <li>Show alert message if User use Chrome v45 and above.</li> </ol> |

## Known Issues:

| Firmware<br>Version | Known Issues   |
|---------------------|--|
| V3.00               | <ol> <li>DBG13120167: Stopped working in IE10 browser during endurance test.</li> <li>DBG13120169: DCS-100 often disconnected to DUT and recording<br/>discontinuously during endurance test.</li> <li>DBG13120173: The endurance test recording uploaded to SMB server<br/>DNS-1200-5 would lag.</li> </ol> |
|                     | 1. Security Holes<br>a. SSL / TLS Renegotiation DoS<br>b. WebVideoActiveX Integer Overflow   |
| V3.01               | c. Unvalidated Redirects<br>d. Command Injection<br>e. Cross Site Scripting<br>f. TLS update to v1.2<br>g. OpenSSL CCS Injection<br>h. CSRF option   |
|                     | i. RTSP can't support VLC<br>j. Change Brute force attack blocking time to 5 min   |

# **Related Documentation:**

N/A