D-Link |

DNR-322L FW Release Notes



Software Version: V3.02.04 **Agent Version:** V2.2.0-b40 **Published Date:** 2018/05/25

Content:

Revision History:	. 2
New Features:	2
Problems Fixed:	. 3
Known Issues:	. 4
Related Documentation:	. 4





Revision History:

Software Version	Date	Model	Hardware Version
V3.01.04	2016/08/26	DNR-322L	B1
V3.02.04	2018/05/25	DNR-322L	В1

System Requirement (minimum HW requirement)

System Minimum Requirements		
Hardware	Two 3.5" SATA hard disk drive	
Requirements		
Network Requirements	Broadband Internet connection (for remote access)	
	Network camera(s) (refer to the D-Link website for a list of supported cameras)	
	10/100/1000 Mbit Ethernet switch or router	
Web-based	Computer with the following:	
Configuration Utility Requirements/Remote	Computer with Microsoft Windows 7, 8, 10, Vista, or XP (with Service Pack 3);	
PC	Mac OS X (10.7 or above)	
Minimum Requirements	PC with Pentium 4 – 2.4 GHz or above; at least 512MB RAM	
	Internet Explorer 8, Firefox 12, Chrome 20, or Safari 4 or higher.	
	Existing 10/100/1000 Ethernet-based network	

New Features:

Software Version	New Features
V3.00.13	1. New model MP FW release
V3.01.04	1. Update the mydlink agent to V2.1.0-b16
V3.02.04	1. Update the mydlink agent to V2.2.0-b40

Enhancements:

Firmware Version	Problems Fixed
V3.00.13	1. Added to use the API set HW Ver. And Serial number.
V3.01.04	 Support Cameras : DCS-936L / DCS-960L / DCS-2530L/DCS-2630L / /DCS-4622/ DCS-4603/ DCS-4701E/ DCS-4703E/ DCS-4802^E/ DCS-5000L/ DSC- 5009L/ DCS-5030L/ DCS-6045L/ DCS-6511B / DCS-6517 / DCS-6915B/ DCS-7513B /DCS-7517/. Upgrade to OpenSSL v1.0.2H



	 Implement LANDAP v1.51 Resolve camera view window issues on DCS-6517. Update NTP Version to 4.2.8p8 Update rules of correction time when synchronizing with NTP servers. Support uid function.
V3.02.04	1. Support Cameras: DCS-2670L / DCS-6517 B1 / DCS-7517 B1/ DCS-P603 / DCS-P703

Problems Fixed:

Version V3.00.13	 Fixed playback View record files window does not display properly in the screen resolution at 1280x960. Fixed D-Lab DBG15120102: Configure IP of DHCP server is 192.168.10.200 but user captures the packages show that IP of DHCP server is still 192.168.10.122(the IP is given from previous DHCP server(DIR-860L)). Fixed D-Lab DBG15120103: Configure IP of DHCP to static, The browser win not redirect to New IP. Fixed D-Lab DBG15120123: After finishing recording schedule on Sunday
V3.00.13	 screen resolution at 1280x960. 2. Fixed D-Lab DBG15120102: Configure IP of DHCP server is 192.168.10.200 but user captures the packages show that IP of DHCP server is still 192.168.10.122(the IP is given from previous DHCP server(DIR-860L)). 3. Fixed D-Lab DBG15120103: Configure IP of DHCP to static, The browser win not redirect to New IP. 4. Fixed D-Lab DBG15120123: After finishing recording schedule on Sunday
V3.00.13	 but user captures the packages show that IP of DHCP server is still 192.168.10.122(the IP is given from previous DHCP server(DIR-860L)). Fixed D-Lab DBG15120103: Configure IP of DHCP to static, The browser win not redirect to New IP. Fixed D-Lab DBG15120123: After finishing recording schedule on Sunday
V3.00.13	not redirect to New IP. 4. Fixed D-Lab DBG15120123: After finishing recording schedule on Sunday
V3.00.13	
	and then continue configure recording schedule on Wednesday. But DNR w delete recording schedule on Sunday. Please check recording file in the attachment.
	5. Fixed D-Lab DBG15120147: After configuring AutoDetection feature, DNR does nothing, please check out recording file in the attachment.
	6. Fixed D-Lab DBG15120158: Please check misspell in the help description
	 Fixed the latency time setting 6 minutes to download Java/Activex in mydlink landing page.
	8. Fixed the smart fan function.
	9. Fixed the buzzer sounded, press power key, still has work.
	1. Fixed the latency time setting 6 minutes to download Java/Activex in mydlink landing page.
	2. Fixed mydlink portal cannot display live streams in relay mode.
	3. Fixed the security bugs: mydlink discovery could initiate without authentication i DNR-322L B1.
	4. Fixed the security bugs: mydlink credential disclosure by DNR-322L B1 device.
	5. Fixed the security bugs: Sensitive information leak during DNR-322L B1 device
V3.01.04	configuration.
	6. Fixed the security bugs: Backdoor in DNR-322L B1.
	. 2
	 Fixed the security bugs: Information leakage issues. Fixed the security bugs: Admin pressured disclosure and change without
	8. Fixed the security bugs: Admin password disclosure and change without authentication.
	9. Fixed the security bugs: Hardcoded non-unique RSA private keys used in HTTP
	10. Fixed the security bugs: Buffer overflow in LANDAP authentication handler.



	 11. Fixed D-track HQ20160602000006: Playback does not work if I select the Time from the Time Range Selection using Firefox. 12. Fiex the security bugs: TCP Off-Path Vulnerability CVE-2016-5696 .
V3.02.04	 Fix Fan Error issue. Fix Liveview cannot change main/second stream Fix Mic cannot use on other account, if once account select then logout. Fix the Liveview not display screen during layout change.

Known Issues:

Firmware Version	Known Issues
V3.00.13	 Export AVI function will not work on MAC OS. Don't support windows area of motion setting.
	3. Don't support HDD 8TB.
V3.01.04	 Export AVI function will not work on MAC OS. Don't support windows area of motion setting.
	 Don't support HDD 8TB. The NVR does not support the motion setting of DCS-2530L, DCS-4622, and DCS-4603.

Related Documentation:

N/A

