



Firmware Version: 2.07rc043
Published Date: 2016/03/22

Content:

Upgrading Instructions:2
 Upgrading by using Web-UI.....2

New Features:3

Changes of MIB & D-View Module:.....3

Problems Fixed:3

Known Issues:.....3

Related Documentation:.....3

Revision History and System Requirement:

Firmware Version	Date	Model	Hardware Version
2.02rc023	2014/12/22	DAP-2360	B1
2.06rc036	2015/07/08		


Upgrading Instructions:

D-Link AP supports firmware upgrading via Web-UI. You may download the firmware from D-Link web site <http://tsd.dlink.com.tw>.

Upgrading by using Web-UI

1. Connect a work station to the LAN port of Access Point.
2. Open the web browser of work station and entering the IP address of the AP. The system default IP address is 192.168.0.50.
3. Enter administrator's username and password, user name is "admin" and leave the password field blank by default.

To update the AP's firmware, click **Maintenance > Firmware and SSL Certification Upload**

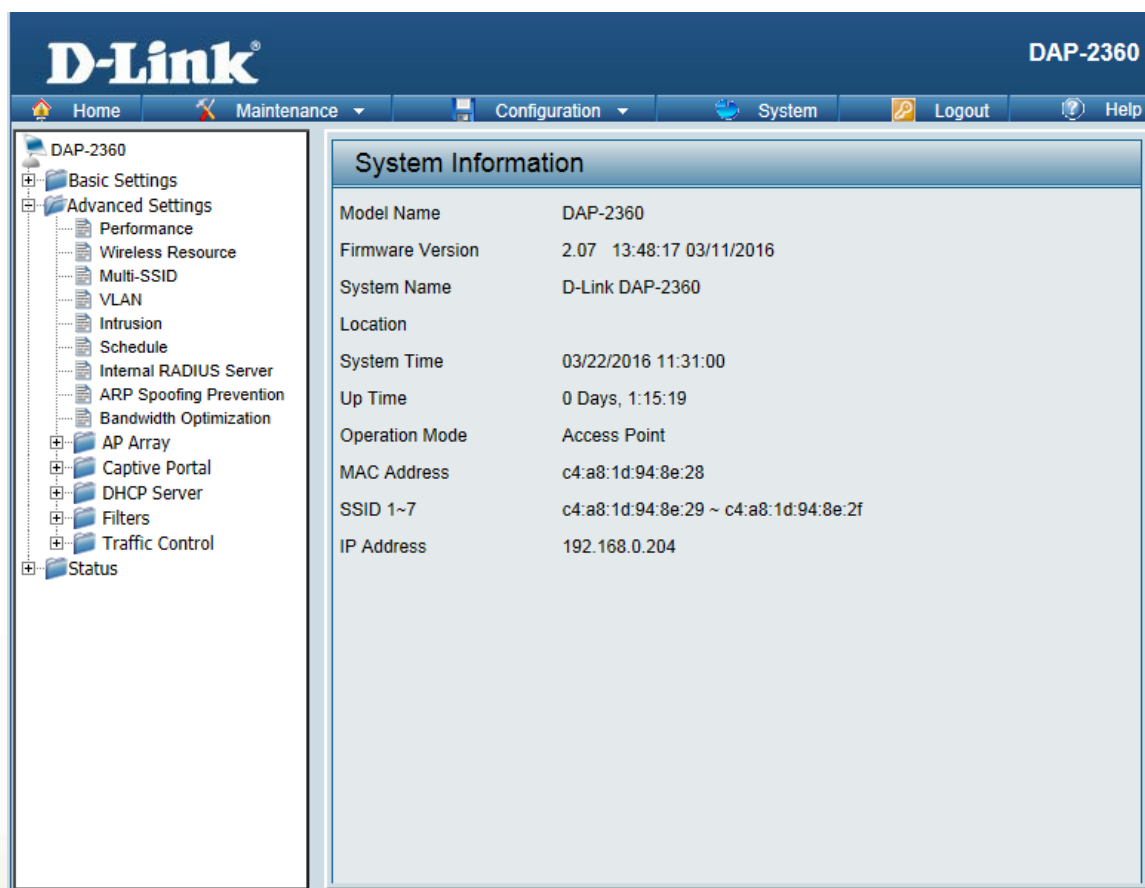

The screenshot shows the D-Link DAP-2360 Web-UI interface. The top navigation bar includes links for Home, Maintenance, Configuration, System, Logout, and Help. The left sidebar contains a tree view of configuration options: Basic Settings, Advanced Settings (Performance, Wireless Resource, Multi-SSID, VLAN, Intrusion, Schedule, Internal RADIUS Server, ARP Spoofing Prevention, Bandwidth Optimization), AP Array, Captive Portal, DHCP Server, Filters, Traffic Control, and Status. The main content area displays the 'System Information' page with the following details:

Model Name	DAP-2360
Firmware Version	2.07 13:48:17 03/11/2016
System Name	D-Link DAP-2360
Location	
System Time	03/22/2016 11:31:00
Up Time	0 Days, 1:15:19
Operation Mode	Access Point
MAC Address	c4:a8:1d:94:8e:28
SSID 1~7	c4:a8:1d:94:8e:29 ~ c4:a8:1d:94:8e:2f
IP Address	192.168.0.204

New Features:

None

Changes of MIB & D-View Module:

None

Problems Fixed:

Firm ware Version	Problems Fixed
V2.07	1. Fixed security issue of web server is vulnerable to buffer overflow while parsing the cookie.

Known Issues:

Firm ware Version	Known Issues
V2.07	None

Related Documentation:

- DAP-2360 User Manual v2.03(DI) & v2.02(US)